

## RELEASE NOTES

The following documents changes/corrections to the program with each Version Release. The latest release incorporates all changes listed.

### **MGSFlood Version 4.43 – August 22, 2017**

- ❖ Corrected bug infiltration statistics that resulted in divide by zero when structure was a copy link.
- ❖ Corrected InfiltrationPondIrregular DLL which could not be called by executable because subroutine name was too long. Included 132 column statement at top to correct issue.

### **MGSFlood Version 4.42 – May 10, 2017**

- ❖ Corrected bug in Open Channel routine where the Right Overbank-Middle Width was switched to the middle Side slope when the file was saved and re-opened.
- ❖ Corrected glitch that caused the optimizer to crash when running precipitation time series from Thurston County. The glitch was caused by MKL spline routine in DischargeRatingCurve routine. All MKL routines had been removed except for this one. Routine now uses linear interpolation routine from MGS.
- ❖ Revised duration matching criteria labels in report to say the durations 1 and 2 must be less than or equal to 0. (*or equal to* added to labels)
- ❖ Recompiled all FORTRAN DLL's

### **MGSFlood Version 4.41 – March 16, 2017**

- ❖ Modified project report to zero out negligible discharges in the peak discharge tables.
- ❖ Modified the percent treated values to correctly report 100% treated when all runoff is infiltrated or filtered.
- ❖ Corrected bug for computing time for infiltration facilities to drain. Divide by zero occurred if infiltration was zero for lower elevations in facility
- ❖ Corrected WSEL frequency plot where program would crash with error 380 code for facilities with depths less than 2 feet.

### **MGSFlood Version 4.40 – June 16, 2016**

- ❖ Included precipitation time series developed by the Department of Ecology for Thurston and Clark Counties
- ❖ Added Clark County area specific HSPF parameters. These parameters are selected from the HSPF region box on the Tools tab. They are also automatically activated when a Clark County precipitation time series is selected.
- ❖ Modified the subbasin land use input screens to accommodate a variable number of pervious and impervious land use types depending on the runoff parameter region selected.
- ❖ Modified the subbasin runoff component screen to accommodate a variable number of pervious land use types.
- ❖ Replaced the wetland hydroperiod analysis routines with the new wetland flow statistics approach in the 2014 Ecology Stormwater Manual.
- ❖ Modified pervious pavement routine to allow for simulation without check dams for long, sloping pavement structures. Added warning message that alerts user when additional check dams could improve pervious pavement performance.
- ❖ Included ability to plot porous pavement gravel trench water surface elevation-frequency statistics on graphics screen and display them in the project report.
- ❖ Corrected time series number displayed in the project report. Number shown in report didn't match the one on the drop down list box on the Main page.
- ❖ Corrected issue writing to internal database files after structure optimizer is run. This error only occurred with Windows 10 operating systems. Correcting this error necessitated turning off the black optimizer status screen. It may be reactivated at a later date.
- ❖ Recompiled all DLL's using latest Intel Fortran compiler

- ❖ Updated InstallShield routine to 2015 release to eliminate Windows 10 incompatibility. Included C++ redistributable module needed for Intel FORTRAN. The C++ redistributable installs prior to the MGSFlood installation screen.

### **MGSFlood Version 4.39 – Internal Release**

#### **MGSFlood Version 4.38 – May 21, 2015**

- ❖ Corrected stability algorithm in routing routine to reduce continuity errors which could be as high as 3 percent in some rare circumstances. The stability routine was corrected and now the continuity errors are within 0.5%
- ❖ Included more detailed link inflow, outflow, filtration, and infiltration volume statistics in project report.
- ❖ Added watershed area summary to beginning of project report.
- ❖ Corrected 25-year WSEL quantile estimate in project report, which was erroneously reporting the 20-year recurrence interval.
- ❖ Eliminated warning message displayed during simulation when volume in infiltration structure was insufficient to compute drawdown time.
- ❖ Eliminated warning message displayed when all values were the same which makes computation of frequency stats impossible.
- ❖ Corrected loading of computed water surface elevation stats from project file. Values were not being loaded from file into memory resulting in all zeros being displayed in report.
- ❖ Corrected erroneous warning message in project report telling user to recompute runoff each time water quality stats were computed.
- ❖ Corrected CAVFS routine so that surface area does not go to zero when CAVFS is dry. Prevents precip and evaporation from being eliminated when CAVFS is empty.
- ❖ Modified InstallShield installation to allow Users group to have Full Control over installation directory.

#### **MGSFlood Version 4.37 – February 10, 2015**

- ❖ Modified Link time series export routine. Exported time series now includes a column called treatment flows, which is the sum of filtered and infiltrated water. This is needed for use with SPU HydroStats
- ❖ Modified routing routine to include a more accurate estimate of infiltrated moisture when the facility goes dry.

#### **MGSFlood Version 4.36 – February 5, 2015**

- ❖ Corrected when message is displayed in report noting that changes have been made and runoff has not been computed. This message is now displayed when changes are made throughout the project input.
- ❖ Added the date when input file was last routed in addition to the report creation date at the top of the project report.

#### **MGSFlood Version 4.35 – January 29, 2015**

- ❖ Added new feature that exports peak discharge with antecedent precipitation for a range of durations. Included Excel Workbook tools for estimating the likelihood of rainfall forecast by the NWS exceeding discharge design rates.
- ❖ Corrected the seasonal statistic routines relating to the season start and end dates. In certain cases the output annual maxima date labels were off by one year.
- ❖ Modified Link/Subbasin export routine to include code to correct for errors in the date/time stamp when exporting with 5-minute time steps. This resulted in different statistical results when the exported files were imported into HydroStats.
- ❖ Updated installation File with InstallShield 2013.

#### **MGSFlood Version 4.34 – February 25, 2014**


- ❖ Time step dependent parameters in the HSPF PERLND routine were not being correctly updated when time steps of 10-minutes or 30-minutes were selected on the Simulate tab. This resulted in an over-estimation of peak runoff rates for simulations conducted with these time steps. Other computational time steps, e.g. 5-minutes, 15-minutes, and 1-hour produced correct results and were unaffected by this correction.
- ❖ The hydraulic rating table calculation array for the bioretention routine was increased. Bioretention facilities with large depths could exceed the array size causing the program to crash.

### **MGSFlood Version 4.33 – December 8, 2013**


- ❖ Bioretention routine was not properly accounting for case where limiting discharge was from biosoil rather than native soil. Infiltration from facility can be limited by either the native soil or the bio-soil infiltration rate times the area of infiltration. Because the infiltration area of the native soil can be larger than the biosoil, a lower native soil infiltration rate can result in the biosoil being the limiting discharge. The program now computes the discharge for both biosoil and native soil to determine the limiting layer at each stage in the facility.
- ❖ The limiting control for bioretention facilities is now output to the project report next to the hydraulic rating table. The control can be one of the following: biosoil, underdrain orifice, or native soil.
- ❖ Corrected routing stability criterion which was mistakenly shifting routing time step to 1 second for infiltration facilities with vertical side slopes where the infiltration rate didn't change on subsequent elevations. This caused long simulation times for these facilities.
- ❖ If infiltration pond is empty and infiltration at bottom exceeds inflow rate, then infiltration flow rate set equal to inflow rate. Before, the infiltration at the bottom was being used, which over-stated the volume infiltrated.
- ❖ Post-developed flow duration curves being plotted in the program lacked resolution at the low end (near the LID sizing flows). Additional points were added to the post-developed duration curve to ensure reasonable plotting in this area. Comparisons between pre and post developed were being done accurately, only the plotting and project report output was affected.
- ❖ Changed interpolation from Cubic Spline to Linear for computing 50-year and 100-yr flow and WSEL Quantiles. Cubic Spline was producing erroneous values for station data analyses.

### **MGSFlood Version 4.31 – May 21, 2013**

- ❖ Modified the bioretention facility routine to allow simulation of vertical side slopes, which is useful for planter simulation. New Bioretention schematic shown below.
- ❖ Modified water quality discharge routine to so that full arrays were being used. Allows routine to compute water quality discharge for sites with little or no impervious surface.
- ❖ Changed bioretention facility so that biosoil was truncated on sides based on maximum possible water level in pond. The maximum level is determined by the elevation entered by the user.
- ❖ Corrects "Runtime Error 9 Subscript Out of Range" Error Message that sometimes occurred with Version 4.29
- ❖ Export Utility was not exporting the total inflow to the link. It was omitting the contribution from precipitation and evaporation in the Inflow.
- ❖ Corrected Licensing Routine that was incorrectly reading permanent licenses and rejecting valid licenses

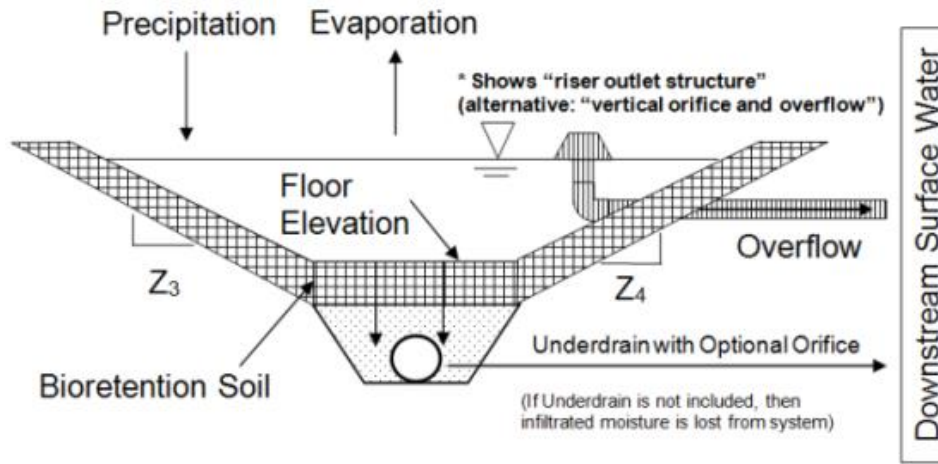

Original Schematic

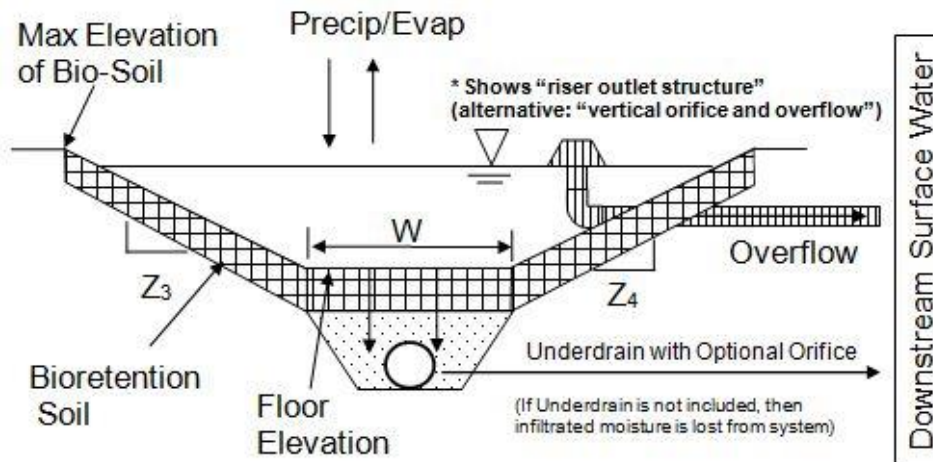

Revised Schematic

**MGSFlood Version 4.29 – February 6, 2013**

- ❖ Modified routing routine so that it uses shorter routing steps to maintain stability when the structure discharge is large relative to the structure volume.
- ❖ Corrected volume calculation in bioretention facility. The volume in the biosoil wedge below the pond bottom on the ends was not being included in the calculation.
- ❖ Settings for default data directory were not being saved in registry. Now corrected.
- ❖ Corrected flow duration compare routine that would sometimes show a very small infiltration facility as passing the duration standard when in fact it wasn't.

**MGSFlood Version 4.28 – July 26, 2012**

- ❖ Corrected glitch in User Elevation Volume table where there were multiple structures in a project. If the user opened a structure and then closed it again without opening the user volume table, the table would be overwritten by table from another structure.
- ❖ Corrected bug in seasonal duration that was triggered when seasonal stats were computed and compute stats for all subbasins and links was selected. Identified by Alex Nguyen on July 12, 2012.
- ❖ Corrected the volume reported in the report which mistakenly added biosoil volume to the total.

- ❖ Added user-defined database MGSUserData.mdb, which allows project-specific precipitation and evaporation data to be used in the model. This is useful for model calibration purposes
- ❖ Changed CAVFS routine so that thickness of compost soil is no longer included in gradient calculation. A constant gradient equal to the slope of the CAVFS is now used.

### **MGSFlood Version 4.27 – May 21, 2012**

- ❖ Added routine, interface, and reporting for seasonal flood-frequency and duration analysis. Up to 12 separate seasons can be performed in a project file.

### **MGSFlood Version 4.26 – May 1, 2012**

- ❖ Corrected hydrograph export utility that was sometimes not exporting hydrographs from links. This is the utility that exports hydrographs of a given duration with frequencies of 2-years through 100-years.
- ❖ Included checks for new Ecology LID Standard.
- ❖ Clarified schematic on bioretention input screen
- ❖ Removed start up directory from registry.
- ❖ Included new license validation routine.

### **MGSFlood Version 4.12 – March 27, 2011**

- ❖ Routing Routine was not stopping when routing flows for structures that were grossly undersized relative to the inflows passing to them. A line in the code that checked for small changes in storage was causing the program to miss the error flag used to terminate when the rating table is extrapolated. An additional error flag was inserted to terminate the program when this occurs.
- ❖ The constant infiltration option wasn't being utilized in initial infiltration pond sizing and resulted in oversized infiltration ponds in the optimizer.
- ❖ When specifying the pond geometry in the structure input screen and project report, a Runtime Error 9, subscript out of range error could occur if the max pond elevation is considerably higher than the riser crest elevation.
- ❖ When stats were computed for all links during a simulation, the program would produce an Error 5 message if there was a structure in the predeveloped condition. The scenario number wasn't being passed to the WQ routine, now corrected.

### **MGSFlood Version 4.09**

- ❖ Precipitation scaling was not being performed correctly for projects that utilize precipitation station data. In many cases a scaling factor of 1.00 was being applied instead of the ratio of the site to station 25-year, 24-hour rainfall. This did not affect any projects that utilize the extended precipitation time series.
- ❖ Water surface elevation stats were not being computed for bio-retention facilities where the water level did not pond on the surface of the bio-soil.
- ❖ User defined HSPF parameters were not being implemented in the model or printed in the project report.
- ❖ The label for soil infiltration was changed from saturated hydraulic conductivity to infiltration rate on the bio-retention soil structure.
- ❖ Corrected flags that require runoff to be recomputed when station scaling factor is changed or when the HSPF default parameters are altered.
- ❖ The project report is automatically refreshed when the report screen is open and the user clicks the show report button on the tool bar.

### **Version 4.08**

- ❖ Water quality flow rate calculations were corrected for simulations where a 15-minute time step was used. Previous versions underestimated the water quality rate when computed using a 15-minute time step,
- ❖ Reporting of water quality discharge rates was absent unless other water quality parameters were computed, this has been corrected,

- ❖ The Hydrograph plotting routine would crash when plotting at time steps less than 1-hour for certain date ranges,
- ❖ Drag and drop icons were not placed properly on the screen of the graphical interface when scroll bars were visible,
- ❖ A message was added warning users that the secondary outlet to a flow splitter must be connected to another reach before routing,
- ❖ The porous pavement hydraulic conductivity was labeled as infiltration rate to avoid confusion with the hydraulic conductivity specified in the Massmann method used in other links

#### **Version 4.07**

- ❖ Updated Routing Routine,
- ❖ Updated bioretention routine to include storage in soil
- ❖ Added pervious pavement routine
- ❖ Modified FlowDurationComp to better handle infiltration facilities
- ❖ Modified optimizer to include new RoutePuls and FlowDurationComp,
- ❖ New license file that sets program to read one timeseries (light version) or standard version.

#### **Version 4.06**

- ❖ Program would crash after optimizing if there were links connected to the optimized link downstream.
- ❖ Project report was corrected so that user defined rating tables would be displayed correctly.
- ❖ Corrected infiltration trench form, which would incorrectly display infiltration rate after closing form.

#### **Version 4.05**

- ❖ Corrected water surface elevation-frequency statistics output in project report, which was producing erroneous results.

#### **Version 4.04**

- ❖ Corrected several graphical interface errors relating to setting point of compliance and optimization toggle.
- ❖ Corrected number of hydrograph ordinates that can be plot. If more than 32000 points selected to plot then an overflow error (GS Server error) would occur.